

INFO TECNICA

Guasto dell'ammortizzatore di vibrazioni dell'alternatore più comunemente conosciuto come puleggia in alluminio-gomma **codice Sidat 455069**

Codice INA :535 0116 10 Codice Sidat invariato 455069

Codice OE:

| | |
|---------|---------------|
| Nissan | A660C-300EX |
| Renault | 82 00 113 636 |

Codice alternatore Mitsubishi: A2TB6481

1) codice Sidat 455069 – codice INA 535 0116 10

Contenuto confezione:

1 ruota libera alternatore
1 rondella distanziale (3,5 mm)
1 calotta di tenuta

A causa di diversi guasti già noti agli addetti ai lavori, consigliamo di far controllare in officina gli ammortizzatori di vibrazioni dell'alternatore ed in caso di guasti eventualmente farli cambiare con una puleggia tradizionale a ruota libera

In un ammortizzatore di vibrazioni difettoso la gomma si stacca dalle parti metalliche. Conseguentemente **non** è più presente la funzione di ammortizzamento.

! Un guasto dell'ammortizzatore di vibrazioni può portare al fermo del veicolo!

2) Montaggio

La INA offre in alternativa una ruota libera alternatore (**Cod. INA 535 0116 10**).

Istruzioni per il montaggio:

1. Smontare la cinghia a sezione trapezoidale
2. Controllare tutti i componenti della distribuzione per vedere se ci sono danni – sostituire i componenti danneggiati
3. Smontare la puleggia originale dall'alternatore
4. Montare la rondella distanziale sull'albero dell'alternatore
5. Montare la ruota libera alternatore cod.
INA 535 0116 10 , **Sidat 455069** con l'attrezzo speciale
6. Montare la calotta di tenuta sulla ruota libera alternatore
! Fare attenzione alla sede corretta!
7. Montare la cinghia a sezione trapezoidale

! Seguire le indicazioni del costruttore del veicolo!

3) Attrezzi speciali

- a. 400 0235 10 (Torx, corto)
- b. 400 0201 10 (Torx, standard)
- c. 400 0200 10 (poligonale incassato, standard)
- d. 400 0234 10 (poligonale incassato, corto)

TECHNICAL INFORMATION

Problems of OAP (Overrunning Alternator Pulley), more commonly known as aluminum-rubber pulley

Sidat Code 455069

INA Code :535 0116 10 Sidat Code: 455069

OE Code:

| | |
|---------|---------------|
| Nissan | A660C-300EX |
| Renault | 82 00 113 636 |

Alternator (Mitsubishi) Code: A2TB6481

1) Sidat Code 455069 – INA Code 535 0116 10

Package Includes:

- 1 OAP
- 1 Spacer washer (3.5 mm)
- 1 Sealing cap

Due to various failures already recognized by testers, we recommend that you check in the repair of the alternator vibration dampers, and in the event of a breakdown, a conventional free wheel pulley can replace it. In a faulty vibration cushion, the rubber is removed from the metal parts. Consequently, the damping function is no longer present.

A vibration cushion fault can lead to a vehicle lock!

2) Assembly

Alternatively, the INA offers a OAP (Cod. INA 535 0116 10).

Assembly Instructions:

1. Remove the V-belt
2. Check all distribution components to see if there any damages- replace damaged components
3. Remove original alternator pulley (see **Photo 2**)
4. Mount the spacer washer on the alternator shaft (see **Photo 2**)
5. Mount the OAP cod. **INA 535 0116 10, Sidat 455069** with a special tool (see **Photo 3**)
6. Mount the seal on the OAP
Pay attention to the correct seat
7. Mount the trapezoidal belt

Follow the vehicle manufacturer's instructions!

3) Special Tools

- a. 400 0235 10 (Torx, short)
- b. 400 0201 10 (Torx, standard)
- c. 400 0200 10 (embossed polygon, standard)
- d. 400 0234 10 (embossed polygon, short)